

Uttar Gujarat Vij Company Ltd ,Mehsana

Half Yearly Oct-08 to March-09

YEAR :-2008-09

Performa-SoP002:-Action taken report for safety measures complied for the accidents occurred

Action taken report for safety measures complied for the Accidents occurred in the six monthly

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
1	DANTIWADA, 3 nos. of Buffalow - Shri Ishwarji Lалуji Bachotra(Thakor)	02/10/2008	FAO	Accident occurred due to heavy wind pressure and cyclone on dated, 02/10/2008 ,at that time LT live conductor swing and came in contact of guarding of 11-kv Dantiwada jgy fdr between location no. 76-77 as a result LT live conductor was broken. While three buffalow passing near to this LT conductor & came in contact and got electrolyte					
2	UNJHA,Kid Buffalow- of Shri Rajput Pratapji Tejaji	02/10/2008	FAO	Tree branches broken on the 1-Ph 2 wire line due to ,dated 02/10/2008 heavy cyclonic strom and rain. Line conductor fall on this kid buffalow and leakage current passed through body.					
3	KHANDORUMA RI,Shri Kamleshbhai Rameshbhai - 20 yrs	10/10/2008	FHO	The Victim working on double pole structure for erection of new transfomer. While removing chain block from top angle of structure he touches the live middle conductor of 11 kv Maneknath feeder which is charged by company staff.	shri kantilal parmar ALM is responsible.	Negaligence of shri kantilal parmar ALM, because L/C returned by kantilal without cheking of contractor labour whose working on line.	Field officers asked to take remedial measures as suggested by E/I.	Necessary instruction passed on to field officers.	
4	PALANPUR,Shri Patel Bhaveshbhai Ganeshbhai - 17 yrs	07/11/2008	FHO	The Victim while cutting the Gulmahor Tree in his Farm, at that time branches of above tree fall down on the 11-KV ITI feeder between location no. 134-135 behind new Gunj bazar. The leakage current passed through above branches to victim on the tree and got electrolyte.	Victim himself is responsible.	Regular tree cutting to be done.	Field officers asked to take remedial measures as suggested by E/I.	Necessary instruction passed on to field officers.	
5	MORVADA,Shri Thakor Jorabhai Paragbhai- 28 Yrs.	12/11/2008	NFHO	As per site investigation dtd, 12-11-2008, Morwada village T/C location no. 448/4/3 D.O. lungur was found open & it was on the ground, also there was found black Dots on 11 KV "R" phase jumper from DO to T/C. so there may be possibility to victim touch with "R" phase live jumper and met with NFH electrical accident.					
6	KHIMMAT,Shri Thakor Manbha Bachubha - 30 Yrs.	03/12/2008	NFHO	While cutting the tree near in his farm house , victim was touch with live HT line of 11-KV Kumor fdr at location no. pole no. 27 & fallen on the ground					

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
7	GOKHANTAR,Buffalow - of Shri Paluben Versibhai Thakor	16/12/2008	FAO	Leakage current passed through earth wire in the Gram panchayat Village T/C. at that time buffalow came in contact and died. Previous day Rain fallen and Land was wet					
8	DHANERA,Shri Patel Dashrathbhai Mohanbhai - 16 Yrs.	08/01/2009	FHO	As per panchnama & eye witness statement, at present first floor construction of madhav trading shop is in process. A victim who is 16 yrs old went to place of accident & tried to catch a string of kite hanging on middle conductor of near by passing 11 kv Dhanera city fdr. There are no dots or any blood impression at any conductor or at bottom of RCC slab where eye witness showed place of accident. There is no any tripping observed on whole day of 8/1/09.It seems victim has come in induction zone of line may be his heart bit stopped due to shock.					
9	GANESHPURA,2 nos. of Cow - Shri Dhana Gopala Thakor.	01/02/2009	FAO	Snnaping of conductor of 11-KV Bhoral JGY fdr between 259/17/45 to 259/17/46 of 66-KV Tadav s/s. both Cow came in contact with the live conductor.					
10	SIDHAPUR,shri maheshkumar prasadilal sharma	30/03/2009	FHO	The laakage current passes through party illegal wiring ,mean while insulation of wire broken and tough with GI string ,so he has drying the clothes on GI string came in contact with leakage current.					
11	BHUTEDI,shri haribhai jivanbhai vaghari	17/03/2009	NFHO	The victim himself climbed on 11 kv badarpura-jgy feeder on location no-6/10 at village bhutedi for unauthorised use of power for lighting purpose and got electric-shock					
12	Dhira Kamboya//1.Thakarda Rameshji Nathaji 2. Thakarda Hemtaji Khengarji 3. Thakarda Vishnuji Ramaji								
13	Derol//Raval Kantibhai Arjanbhai	24.11.08	NFHO	The jumper of 11 KV Vasan Ag feeder burned,all three victims had tried to repair thameseives, while they were on the t/c , got non fatal electrical shock .					
14	Kathroti//Makwana Nakunbhai virjibhai	18.11.08	FAO	In the slope area , and due to less clearence b/w ground and wires, the camel came in contact with the live wire, thus got shock and died.					
15	Kamalpur//Rabari Shivabhai Govabhai	28.7.08	FAO	During rain , due to fault in service wire of consumer the return power came to the t/c ,and thus leakage current passed through the earth wire of t/c, the victim came in contact with ther wire, got shock and died.					

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
16	m.pura//rabari mithabhai kakabhai	13.7.08	FAO	No evidence found about electrical accident as per detail investigation report, but the p.m. report says it as electrical accident.					
17	Prantij//Makvana Vishnuji Balaji	1.12.08	FAO	the owner had moved his meter of house from home to pole, so the phase wire from meter touched to the earth wire of pole, and return power came back to the t/c , and the cows came in contact with earth wire of t/c, got shock and died.					
18	Talod//Rabari Jemurbhai Khodabhai(2 no) & Rabari Arvindbhai Versibhai(1)	4.12.08	NFHO	While tree cutting the branch of the tree fallen on the wire passing nearby the tree, so while removing the branch with the help of iron rod, he got momentary shock and gopt non fatal shock.					
19	Talod//Makwana Gopalsinh Shivsindh	22.12.08	FAO	Ground clearance of 11kv Karmipura feeder was lower due to Lose pin binding and 3 Camels passing nearby line comes in contact with live wire and died on the spot.					
20	Bhiloda-i//Rathod Danjibhai Ramjibhai	23.12.08	FHO	Accident occurs at Consumer premises and detailed investigation report follows					
21	Sathamba//Kanu bhai Hirabhai Vora	28.12.08	FHO	fallen from s/l pole ,got mech injury and died.					
22	Mod.T // No owner found	28.12.08	NFHD	Victim got shock due to mis-identification of the line.He has to replace the burned jumper of 11 kv savela feeder, but he had taken L/C of 11 kv Indran feeder, so because of such mistake he got non fatal accident.					
23	hatharva//Dipakbhai Laxmanmbhai Thakarda	16.1.09	FAO	Due to thread of kite, the conductor was broken during uttarayan, and the cow came in contact with snapped conductor, got electric shock and died.					
24	Zer//Kharol Babubhai Ukaraji	10.2.09	NFHO	Victim climb on the stair to decorate the tent and came in contact with the live 11 kv Bhandwal feeder and got non fatal electric shock.					
25	Zer//Kharol Babubhai Ukaraji	15.2.09	NFHO	A person of contractor was working of 1 ph stringing line, the 1 ph 2 wire was crossing to ag line , so while stringing the new line , the wire touched together at crossing so the victim got non fatal electric shock					
26	Kadi / R P Patel	10/04/2008	NFH (O/S.) to R.P.Patel.	While painting the wall of perapet which was constructed illegally near 11 Kv line & due to wrong working method, he touched with the line & met with NFA.					
27	Dabhla / 2 Nos. cows of L C Rabari	10/05/2008	FA to 2 Nos.of cow of Shri L.C.Rabari	One piece of Al.wire ring was found on LT line which was touching with one phase wire & fabrication of the poll, so leakage current passed through earthing,cows came in contact & electrocuted.					

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
28	Vijapur / Shyamsundar S.	31/10/2008 10/11/2008	Fatal-Human outsider	Victim:- Shyamsundar S. , victim was travelling on truck, he stood up on cabin and came into contact with live 11 kv wire passing above the truck and got shock.					
29	Mansa / Kum.P.M.Marvadi & Kum.J.D.Nai.	.12/12/08	NFH (O/S.)	While flying kite from the tarrace of the Temple, she came in contact with 11 kv line.					
30	Saduthala / Calf	12/01/2008	Fatal Aimal Calf - 3 Nos.	Owner:- Shri H.J.Patel, Due to fire occurred by another reason (except the electric line fault / short circuit / service cable fault) in the room of farm house, some dry grass food & 3 Nos. of calves burnt & dead which were kept in that room at the time of fire.					
31	Gawada / Menaben.B.Thakor	23/12/08	Fatal Human Outsider	Accd. was occurred at con's premises. Victim came in contact with live plug of 1ph. motor at her resident.					
32	Deloli / Buffalo	01/01/2009	Fatal Aimal Buffallow	Owner:- Shri R.D.Patel, Leakage current flows from the st. light fixtures due to insulation cut by the squirrel, buffalo came in contact & electrocuted.					
33	Dunawada / V.K.Thakor	16/12/08	NFH (O/S.)	While charging Ag.T/W through starter, victim got shock. Report recd. late from police ststion. Victim is mentally ill.					
34	Mevad / Buffalo	20/1/09	Fatal Aimal Buffallow	Owner:- Shri M.M.Chaudhary, Leakage current flows from the faulty motor of the consumer. Buffalo came in contact & electrocuted.					

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
35	Itadara / K.H.Chaudhary	02/02/2009	Fatal Human Outsider	Accd.occured due to touching of 6 feet long iron ladder which was in the hand of victim to the 11kv Parbatpura JGY fdr. Accd. Occurred due to leathargicness of victim.					
36	Bilodra / K.P.Parmar, Helper	02/11/2009	Fatal Human Dept.	While releasing new 1ph. Connection from the LT pole, he might have got shock & met with FA.					
37	Padharia / K.F.Parmar, Helper	02/12/2009	NFH (Dept.)	While providing x-mer centre to 1ph - 2 W LT line connection of farm house, victim climed on the x-mer centre without isolating the D.O. fuse & while doing so, victim came in contact with 11kv jumper & met with NFA.					
38	Bavla / 1) Vijay P Thakor & 2)Sajjanben Koli Patel	10/03/2008	Fatal-Human outsider	Victim (1) Vijay P Thakor(18 Yrs.) , (2) Sajjanben Koli Patel ,32 Yrs. while loading wet peddy ash (waste) in truck under 11 kv Bavla-4 line , came into contact with 11 kv line and got shock. Intimation received through News paper. Detail report under investigation.					
39	Pundrasan / Buffalo of Shri Radhuji Thakor	10/01/2008	Fatal Aimal	Buffallow of Shri Radhuji Thakor , Live LT line cond of Village TC snapped and fallen down on Buffallow.					
40	Melaj / Cow of Nareshkumar V Desai	10/05/2008	Fatal Aimal Cow	Owner Nareshkumar Virambhai Desai,Manipura village w/w connection service with joint,live wire touched the stay wire of PSC pole and leakage current passed through, a cow came in contat with stay wire and got electric shock	Site Inspected by AEI on 20.9.08 but Report awaited				Rs.2000/ paid as 50 % by ACE,SB T
41	Bareja / Shri Chandubhai Jagubhai Bhoi	10/10/2008	Fatal Human Outsider	Victim Shri Chandubhai Jugabhai Bhoi,at village Bareja due to party side wiring fault while attending faulty motor.	FAULT NOT ON UGVCL SITE				

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
42	kaliyapara / Buffalo of Shri Dolubhai Vasrambhai Bhardwaj	10/11/2008	Fatal Aimal Buffallow	Owner Shri Dolubhai vasrambhai Bharwad,leakage current passed through Ag Transformer centre					
43	Telav / Samir Alibhai Momin	24/10/2008	Fatal Human Outsider	Victim Shri Samir Alibhai Momin was playing on truck which was filled with grass,victim was touched to 11 KV Shella feeder and He was died.	AWAITED	AWAITED	NO	PUBLIC AWARENESS DONE TO AVOID ACCIDENT	NO APPLICATION RECEIVED
44	Dhanot / Unknown person	01.11.08	Fatal-Human outsider	Unknown person climbed on Girder pole of 11 kv GMT line feeder on Kadi chhatral road near Virat alloys pvt ltd and made suicide ,It is come to knowledge from 04.11.08 Divyabhaskar news paper	REPORT AWAITED	Victim has tried to suicide.	Field officers asked to take remedial measures as suggested by E/I.	Necessary instruction passed on to field officers.	NIL
45	Mokhasan/Buffalow of Shri Rabari Khodabhai Mansangbhai	15.11.08	Fatal Animal Buffallow	No leakage current found during site visit	REPORT AWAITED	Proper line maintenance should be done	Field officers asked to take remedial measures as suggested by E/I.	Necessary instruction passed on to field officers.	NIL
46	Chhala/Shri N.M.Dave Helper	17.11.08	Non Fatal-Human Departmental	Shri N.M.Dave ,Helper-Victim was working on LST gentry of 11 KV Sorabpura AG feeder,and during work plier may be touch to 11 kv bus passing near with gentry and he fell down.					
47	Kaiyal/Cow of Shri Sagarambhai Punabhai Desai	28.11.08	Fatal Animal Cow	leakage current flow through waterwrks motor of SGP village Kaiyal to earthing of village Tc ,Cow came in contact with earthing wire and get electrocuted	REPORT AWAITED	Proper line maintenance should be done	Field officers asked to take remedial measures as suggested by E/I.	Necessary instruction passed on to field officers.	NIL
48	Magodi/Victim Shri Dasarathbhai Bachubhai Bihola age app 35 yrs	02.12.08	Fatal-Human outsider	LT neutral wire of village TC broken and fall in mud,victim's leg came in contact, due to mud leakage current through neutral wire continue and get electric shock,Villagers had informed Village helper.					
49	Virochan nagar/ Buffalow of Shri Jayrambhai Taljabhai Rabari	19.12.08	Fatal Animal Buffallow	At the time of site verification no leakage current was found w/w village TC					

Sr. No.	Location of Accident and details of the victim	Date of occurrence	Type of Accident	Cause of Accident	Finding of CEI / EI/ AEI	Remedies suggested by CEI / EI/ AEI in various cases	Whether the remedy suggested is complied	Action taken to avoid recurrence of such Accident.	Compensation Paid
1	2	3	4	5	6	7	8	9	10
50	Badarkha /Shri Jagdishbhai Bhailalbhai Patel	28.12.08	Fatal Human Outsider	leakage current passes through load side terminal of motor and capacitor,wire touches to flour mill body,victim came in contact with flour mill body and get electric shock(Party side fault)					
51	Adalaj/ Shri Rajaji Mathurji Thakor	12.01.09	Fatal-Human outsider	While removing faulty motor from borewell,try to shift Tripod under the line and it touches with the 11 kv Kudasan JGY feeder and get electric shock and died.					
52	Lihoda/Shri Vasantbhai Jivabhai Patel Age 46	26.01.09	Non Fatal-Human outsider	On ag TC one LT circuit line wire was broken,cable removed from T/C,try to reconnect healthy circuit by removing Tapping DO,which is direct.and try to provide DO of TC by hand get electric shock and fell down					
53	Matoda / Shri Nankubhai Govindbhai Patel age 28 yrs	28.01.09	Non Fatal-Human outsider	A Victim was met an electrical accident while measurement of 11 KV Lodariyal feeder,Victim's shoulder touched line.Detail Investigation report awaited	AWAITED	AWAITED	NO	PUBLIC AWARENESS DONE TO AVOID ACCIDENT	NO APPLIC ATION RECEIVED
54	Ambali/Buffalow of Shri Karman bhai rahabhai & parmar Kamabhai Jinabhai	02/04/2009	Fatal-Animal Buffalow	Due to 11 KV Pipali fdr wire snapping .					
55	GIDC Naroda	9.3.09	Fatal-Human (Departmental)	On 9.3.09 outage of 66KV Naroda S/S was confirmed and mass maintenance was kept at GIDC Naroda and 8 gangs were deputed (4 of this division and 4 of other divisions).Maintenance was kept on 11KV GIDC-5 feeder. Shri Jayantibhai Ranchhodbhai Patel Helper Dholka R was working at location No. 24/A, suddenly power came at about 15:35 pm victim got electrocuted.	AEI Visited on 10.3.09, Report awaited				
56	Harkhji Na Muvada/Sajjansinh V Chauhan age 40 yrs	28.3.09	Fatal Human(Outsider)	Message of accident received from Dehgam Police station at 14:30 p.m.on Dtd:29.3.09.After investigation by DE,Dehgam(R) following details was found:In Kesarisinh Nathusinh Chauhan's house,there is internal problem of circuit at load side,Victim(Sajjansinh V Chahuan,AGE:40), had gone to repair this fault.There was open joint near the meter at load side wiring.And insulation of wire was deteriorated and seperate from conducting part of wire.When the victim touched with this open wire,got shocked and electrical accident took place.					
57	Chharodi(N.C.Pura)/ Shri Rajubhai Yadav	28.3.09	Fatal Human(Outsider)	Victim Shri Rajubhai Yadav,Tata Motors Ltd (Fatal accident):- While transporting a girder,pole through crane upper portion of the crane touch the 11 kv Sunanda feeder live conductor					